


TOPCO HIGH SPEED SUCKER ROD SPINNER

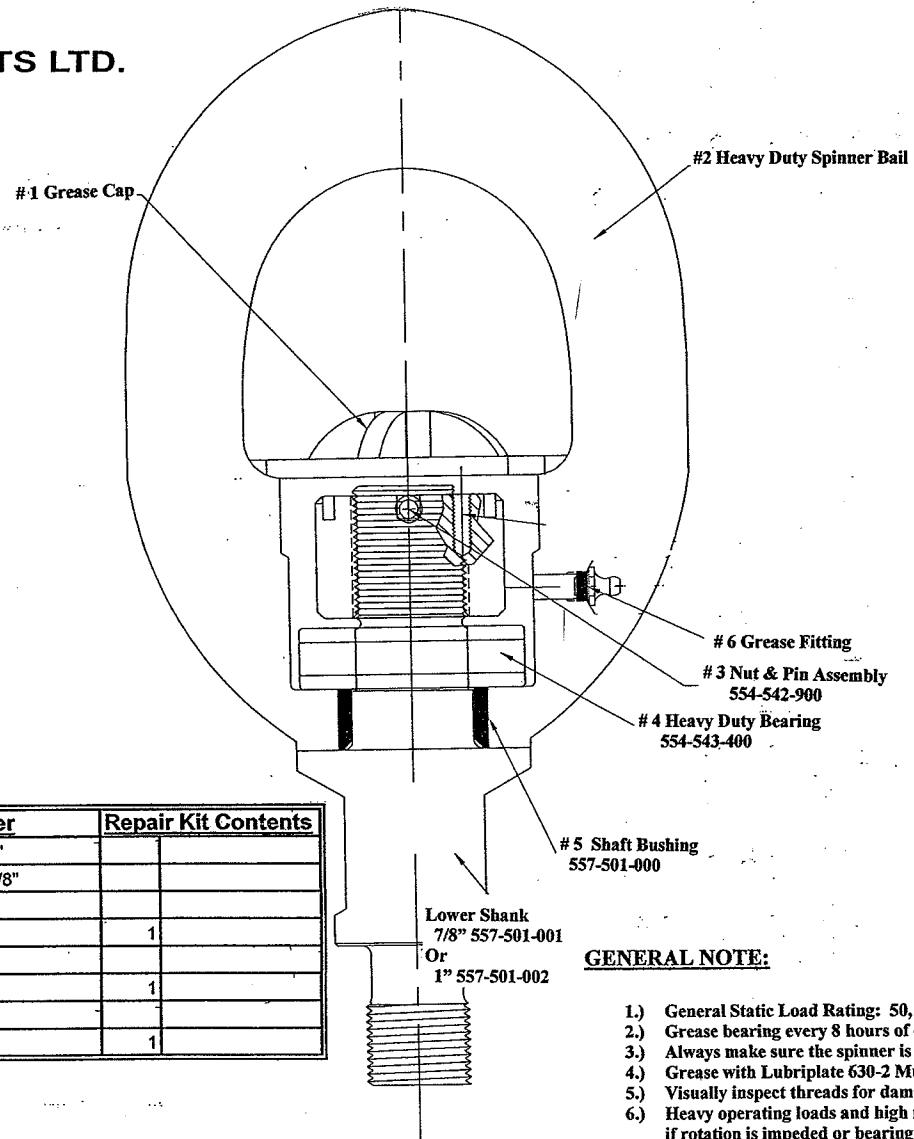

DESCRIPTION	Part Number	Repair Kit Contents
SR Spinner	557-501-600 1"	
SR Spinner	557-501-500 7/8"	
Components		
#1 Grease Cap c/w O-Ring	554-542-500	1
#2 Bail		
#3 Nut & Pin Assembly	554-542-900	1
#4 Hi Speed Bearing	554-543-400	
#5 Shaft Bushing	557-501-000	1

GENERAL NOTE:

- 1.) General Static Load Rating: 50,000 Lb's
- 2.) Grease bearing every 8 hours of operation.
- 3.) Always make sure the spinner is greased properly.
- 4.) Grease with Lubriplate 630-2 Multi Purpose Grease.
- 5.) Visually inspect threads for damage before every operation or making connection.
- 6.) Heavy operating loads and high rotational speeds reduce bearing life: replace bearing if rotation is impeded or bearing is damaged.
- 7.) Check that lower shank freely rotates before use.
- 8.) Inspect and recertify annually.

WARNING: The maximum rated load of spinners, hooks, and swivels is determined without applied torsional loading. Torsional loading caused by defective or seized bearings reduces the maximum rated load and voids any warranty provided by "Topco Oilsite Products Ltd.."